

Blocs de raccordement


Distribution frames

Verteilerblock

BLOCS DE RACCORDEMENT AVEC SORTIES SUR UN CÔTÉ

DISTRIBUTION FRAMES WITH OUTLETS ON ONE SIDE

VERTEILERBLOCK MIT AUSGÄNGEN AUF EINSEITE

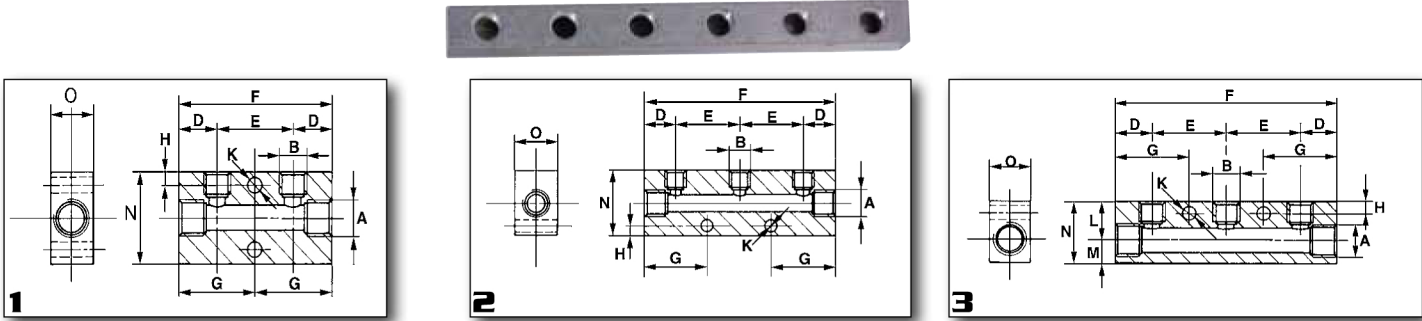

C = nombre de sorties - number of outlets - Ausgängenummer

TYPE	ENTRÉES	SORTIES	A	B	C	D	E	F	G	H	K	L	M	N	O	Kg	TYPE DE
CODE	INLETS	OUTLETS															SCHÉMA
	2 - G1/8	2 - M5	G1/8	M5	2	15	15	45	22,5	3,5	4,25	-	-	20	15	0,032	1
	2 - G1/8	3 - M5	G1/8	M5	3	15	15	60	22,5	3,5	4,25	-	-	20	15	0,043	2
	2 - G1/8	4 - M5	G1/8	M5	4	15	15	75	22,5	3,5	4,25	-	-	20	15	0,053	2
	2 - G1/8	5 - M5	G1/8	M5	5	15	15	90	22,5	3,5	4,25	-	-	20	15	0,064	2
	2 - G1/8	6 - M5	G1/8	M5	6	15	15	105	22,5	3,5	4,25	-	-	20	15	0,074	2
	2 - G1/4	2 - G1/8	G1/4	G1/8	2	15	30	60	30	4,5	5,25	-	-	30	20	0,080	1
	2 - G1/4	3 - G1/8	G1/4	G1/8	3	15	30	90	30	4,5	5,25	-	-	30	20	0,115	2
	2 - G1/4	4 - G1/8	G1/4	G1/8	4	15	30	120	30	4,5	5,25	-	-	30	20	0,158	2
	2 - G1/4	5 - G1/8	G1/4	G1/8	5	15	30	150	30	4,5	5,25	-	-	30	20	0,200	2
	2 - G1/4	6 - G1/8	G1/4	G1/8	6	15	30	180	30	4,5	5,25	-	-	30	20	0,240	2
	2 - G3/8	2 - G1/4	G3/8	G1/4	2	18	36	72	36	6	6,5	-	-	40	20	0,110	1
	2 - G3/8	3 - G1/4	G3/8	G1/4	3	18	36	108	36	6	6,5	19	11	30	20	0,120	3
	2 - G3/8	4 - G1/4	G3/8	G1/4	4	18	36	144	36	6	6,5	19	11	30	20	0,160	3
	2 - G3/8	5 - G1/4	G3/8	G1/4	5	18	36	180	36	6	6,5	19	11	30	20	0,205	3
	2 - G3/8	6 - G1/4	G3/8	G1/4	6	18	36	216	36	6	6,5	19	11	30	20	0,250	3
	2 - G3/8	2 - G1/8	G3/8	G1/8	2	18	30	66	33	4,5	5,25	-	-	40	20	0,137	1
	2 - G3/8	3 - G1/8	G3/8	G1/8	3	18	30	96	33	4,5	5,25	19	11	30	20	0,120	3
	2 - G3/8	4 - G1/8	G3/8	G1/8	4	18	30	126	33	4,5	5,25	19	11	30	20	0,160	3
	2 - G3/8	5 - G1/8	G3/8	G1/8	5	18	30	156	33	4,5	5,25	19	11	30	20	0,205	3
	2 - G3/8	6 - G1/8	G3/8	G1/8	6	18	30	186	33	4,5	5,25	19	11	30	20	0,250	3
	2 - G1/2	2 - G1/4	G1/2	G1/4	2	22	36	80	40	6	6,5	-	-	40	28	0,200	1
	2 - G1/2	3 - G1/4	G1/2	G1/4	3	22	36	116	40	6	6,5	20	20	40	28	0,240	3
	2 - G1/2	4 - G1/4	G1/2	G1/4	4	22	36	152	40	6	6,5	20	20	40	28	0,315	3
	2 - G1/2	5 - G1/4	G1/2	G1/4	5	22	36	188	40	6	6,5	20	20	40	28	0,395	3
	2 - G1/2	6 - G1/4	G1/2	G1/4	6	22	36	224	40	6	6,5	20	20	40	28	0,470	3
	2 - G1/2	2 - G3/8	G1/2	G3/8	2	25	40	90	45	6	6,5	-	-	40	28	0,180	1
	2 - G1/2	3 - G3/8	G1/2	G3/8	3	25	40	130	45	6	6,5	20	20	40	28	0,265	3
	2 - G1/2	4 - G3/8	G1/2	G3/8	4	25	40	170	45	6	6,5	20	20	40	28	0,350	3
	2 - G1/2	5 - G3/8	G1/2	G3/8	5	25	40	210	45	6	6,5	20	20	40	28	0,430	3
	2 - G1/2	6 - G3/8	G1/2	G3/8	6	25	40	250	45	6	6,5	20	20	40	28	0,515	3
	2 - G1/2	2 - G1/2	G1/2	G1/2	2	30	40	100	50	6	6,5	-	-	40	28	0,195	1
	2 - G1/2	3 - G1/2	G1/2	G1/2	3	30	40	140	50	6	6,5	20	20	40	28	0,275	3
	2 - G1/2	4 - G1/2	G1/2	G1/2	4	30	40	180	50	6	6,5	20	20	40	28	0,355	3
	2 - G1/2	5 - G1/2	G1/2	G1/2	5	30	40	220	50	6	6,5	20	20	40	28	0,435	3
	2 - G1/2	6 - G1/2	G1/2	G1/2	6	30	40	260	50	6	6,5	20	20	40	28	0,510	3